

JUNIPER® THIN Primaries Suspension Remote Installation Guide



MOUNTING POINTS DIMENSIONS

- * FOR 24" LIGHT SEGMENTS
- ** FOR 36" LIGHT SEGMENTS

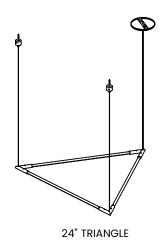

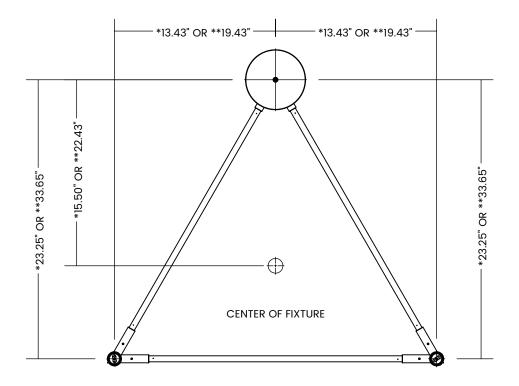


WARNING

A LICENSED ELECTRICIAN SHOULD PERFORM INSTALLATION. DISCONNECT MAIN POWER AT THE SOURCE PRIOR TO INSTALLATION.

INSTRUCTIONS MEANT FOR A REMOTE CLASS 2 DRIVER.

STEP 1: MARK MOUNTING POINTS WITH TEMPLATE

Carefully mark the mounting points with a pencil or marker, using the spacing in Figure 1. Slots on provided mounting brackets ensure that mounting points are properly distance and fall on a straight line.

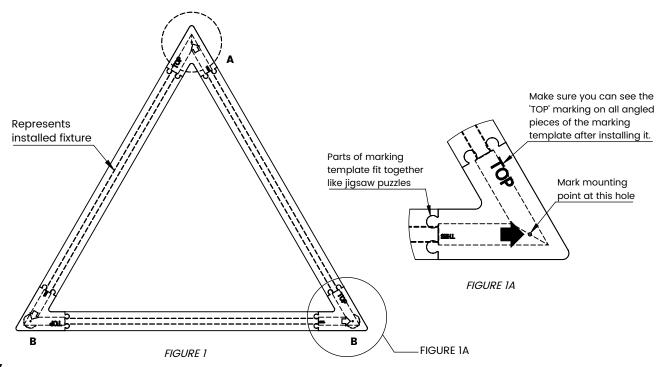


KEY

- POWER SLEEVES MOUNTED BENEATH CANOPY PLATE OR MINI MOUNTING PLATE (SEE POWER FEED OPTIONS).*
- PASSTHROUGH SLEEVES USED TO CONNECT SEGMENTS TOGETHER. MOUNTED AT ALL NON POWERED CORNERS OF THE FIXTURE

Assemble the marking template in the shape of your fixture to mark mounting points.

- For flat ceiling, install the marking templates directly on the ceiling. 1.
- For sloped ceiling, assemble the marking template on the floor and place laser pointers on the mounting point holes to project 2. them onto the sloped ceiling.

POWER FEED OPTIONS

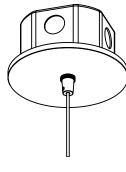

CANOPY PLATE

FOR FIXTURES WIRED TO A JUNCTION BOX.

SEE STEP 2A FOR DETAILED INSTALLATION AND WIRING INFORMATION.





MINI CANOPY

FOR FIXTURE MOUNTING DIRECTLY TO THE CEILING.

SEE **STEP 2B** FOR DETAILED INSTALLATION AND WIRING INFORMATION.


FIGURE 2

WWW.JUNIPER-DESIGN.COM


INFO@JUNIPER-DESIGN.COM +1 347 799-2915 157 WATER STREET SOUTHINGTON, CT 06489

JUNIPER®


STEP 2A: JUNCTION BOX COVER PLATE INSTALLATION INSTRUCTIONS

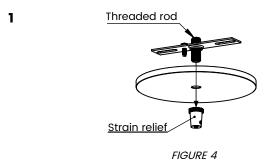


Remove strain relief from the canopy cover to release the crossbar.

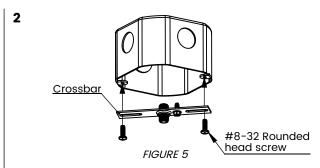


Attach the crossbar to the junction box using provided #8-32 round head screws.

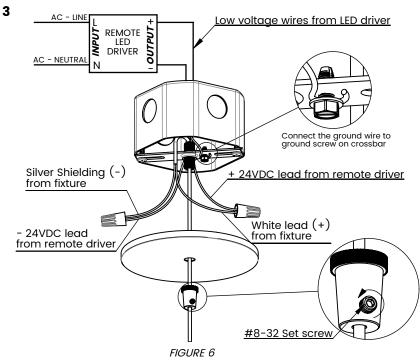


Loosen the #8-32 set screw on the strain relief. Pass power cable through threaded rod and strain relief as shown. Connect wires according to diagram (wire nuts provided). Wires to and from the driver are not included.

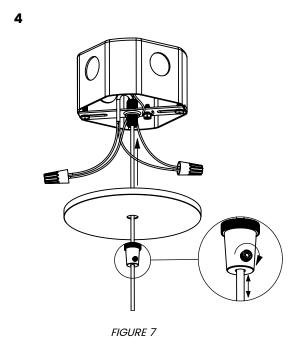

Push wires inside the junction box and screw the strain relief into threaded rod to attach canopy plate to junction box. **Length of power cord should be** adjusted for desired suspension height. Tighten the screw on the strain relief after adjustment.

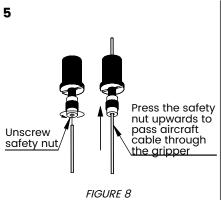

Partly loosen safety nut on cable gripper. Feed aircraft cable through the gripper. Do this for all aircraft cable ends.

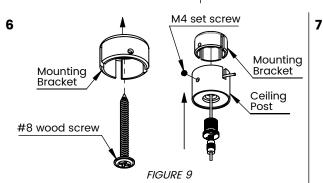

Install mounting brackets at all B and C mounting points using provided #8 wood screws. Pass the extra aircraft cable through the slot in ceiling post and screw gripper into ceiling post. Attach ceiling post to mounting bracket using provided M4 set screw.

Alternate screws may be used at the recommendation of an electrician

recommendation of an electrician.

Use the slot on mounting bracket to make finer adjustment to mounting positions.



Adjust aircraft cable length as needed. Press safety nut on gripper to loosen aircraft cable. Tighten safety nut in completely when finished. Do not cut extra aircraft cable until full fixture is assembled and desired suspension height is achieved.


WWW.JUNIPER-DESIGN.COM INFO@JUNIPER-DESIGN.COM +1 347 799-2915 157 WATER STREET SOUTHINGTON, CT 06489

STEP 2B: MINI CANOPY INSTALLATION INSTRUCTIONS

Mounting Bracket

FIGURE 11

Install mounting bracket at A mounting points using provided #8 wood screws.

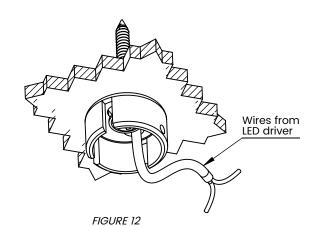

Drill a hole through the mounting bracket slot using a 1/8" drill bit, which will be used to receive low voltage wires from remotely located LED driver.


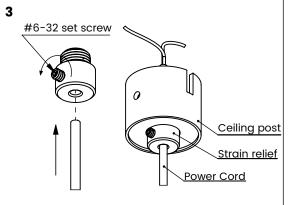


FIGURE 13

Loosen the #6-32 set screw on the strain relief. Pass power cable, through strain relief as shown.

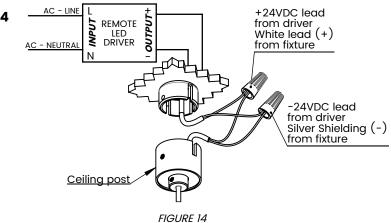

Connect wires using provided wire nuts and push the wires along with the wire nuts into the ceiling post. Attach ceiling post to mounting bracket using provided set screw. Length of power cord should be adjusted for desired suspension height. Tighten the screw on the strain relief after adjustment. Wires to and from the driver are not included.

STEP 3: LIGHT TUBE INSTALLATIONS


NOTE: Figure 15 shows TRIANGLE as an example. Please install the correct number of light tubes according to your fixture's configuration. The instructions below are same for all PRIMARIES.

The THIN Suspension fixture is designed with an innovative magnetic connection. Simply insert the light tubes into their sleeves for electrical contact to be made. To ensure that the light segments are level, use of a laser level is highly recommended.

1. Reconnect main power and insert light tubes into the power end. Push light tubes in carefully until they illuminate.

2. Push following passthrough sleeve onto illuminated light tubes. Add light tubes and sleeves as needed according to your segment configuration.

WWW.JUNIPER-DESIGN.COM

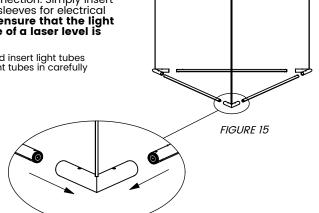

CARE INSTRUCTIONS

Brass will patina over time like other natural metals and regular care is required in order to retain the quality finish of your THIN fixture for years to come.

Gently wipe with a damp cloth to remove dirt, dust, and fingerprints.

Do not use any chemical cleaning solution.

Use indoors only.

INFO@JUNIPER-DESIGN.COM | +1 347 799-2915 | 157 WATER STREET SOUTHINGTON, CT 06489